




Diagnostics manual

-


40XX Control box Immersed COVEO

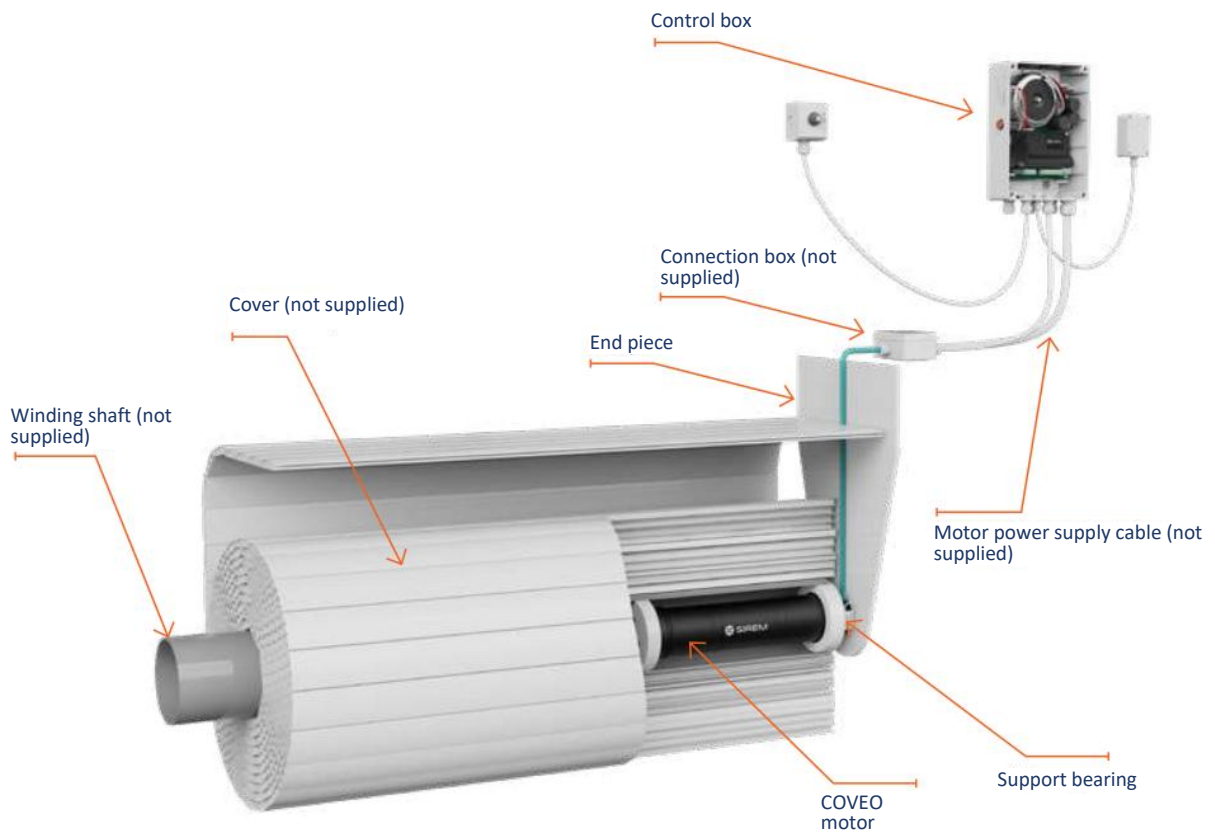

This document will help you to identify the origin of the problem and try to resolve it.
If the problem persists after troubleshooting, we invite you to contact your motorised cover manufacturer.

	Title	COVEO Diagnostics Manual - 4020	Product	COVEO
	Cat.		Instruction	Rev.
			Property of SIREM	

2.3 Overcurrent

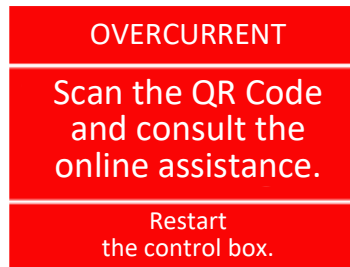


The cover stops each time the key is turned after moving just a few centimetres.

OR

The cover has stopped, but it has not reached the end.

This exceeds the current threshold set when the box was calibrated.

- ➔ Check the correct settings for the motor in MENU / SETTINGS / Type of motor.

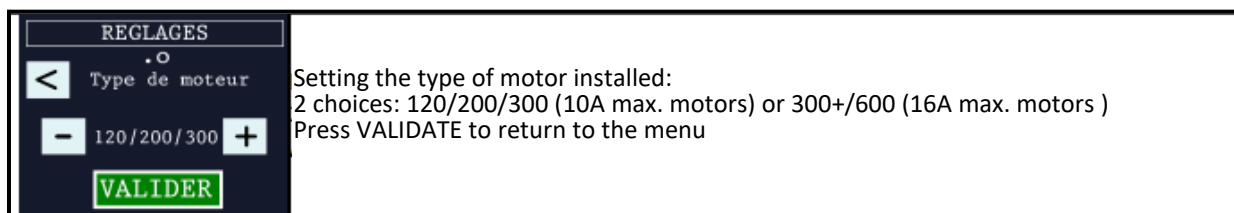

- ➔ Check that there is nothing blocking the movement of the cover.
- ➔ Check that the motor torque (Nm) matches the size of the pool and the depth of the axis. (Contact your retailer)
- ➔ Recalibrate (reboot + 5 deploy/retract movements) to see if the problem persists.
- ➔ Check the date of manufacture of the control box and the software version.

If the control box is prior to OF: 11-2022 and its software version is 2.3/1.8 then contact your retailer to have the software updated.

End of the diagnostics